



VEHICLE REPORT

Lexus NX Series

2020

VIN | JTJYERBZ4M0101001

RISK GRADE

B+

● Moderate



GENERATED

Apr 16, 2026



FUEL TYPE

Gasoline



VIN JTJYERBZ4M0101001



REPORT ID

#bd3c127c5ab2

Overall Evaluation

Vehicle risk assessment and purchase recommendation



VEHICLE CONDITION

Excellent Condition

● Approved for Import

Vehicle is in excellent mechanical and structural condition with consistent maintenance and no major incidents.

KEY FINDINGS

5

- Excellent body structure and overall grade 'S'

Based on: Body structure assessment found all components in normal condition with an overall grade of 'S' and rating of 100.



- Consistent manufacturer-recommended maintenance history

Based on: 13 documented service events at regular 10,000 km intervals with verified odometer readings and no anomalies.



- No evidence of major structural, water, or fire damage



Based on: No water, fire, or structural damage flags were raised in vehicle history and inspections.

- Two minor collision incidents in the last five years



Based on: Vehicle history shows two minor collisions with settled property damage claims.

- Gaps in insurance coverage



Based on: There is currently no active commercial or compulsory insurance, and commercial coverage lapsed 90–180 days ago.



RECOMMENDATION



Approved for Import

Vehicle shows excellent structural integrity and a clear, consistent maintenance record with only minor collision history, making it a strong candidate for import.

Vehicle Identity

Complete specifications and identification details

2020 Model Lexus NX Series 2.0L CVT Edge Edition (LEXUS NX200)

BRAND

Lexus

SERIES

Lexus NX Series

YEAR

2020

MANUFACTURER

Lexus

VIN JTJYERBZ4M0101001



Engine

Displacement

2.0L

Engine Model

3ZR

Fuel Type

Gasoline

Fuel Grade

93 RON (Beijing 92 RON)

Emission Standard

China VI



Transmission

Gearbox

CVT

Drive Type

Front-engine, front-wheel drive



Dimensions

Wheelbase
2660 mm



Weight & Capacity

Seats
5

Doors
Five doors



Classification

Vehicle Class
SUV



Market Information

MSRP
¥304000.0

Market Date
201909

Vehicle Title

Title status assessment and implications

 Clean



Clean Title

The vehicle has only minor collision incidents with no major structural, flood, or fire damage and all inspection components are in normal condition. Settled minor claims and an excellent body grade support a clean title determination.

KEY FACTORS

1

Excellent structural inspection



Based on: Independent body inspection found all structural components in normal condition with an overall grade of "S" and a rating of 100.

2 Minor collision history only



Based on: Records show two minor collision incidents over the past five years with no major accidents or serious damage.

3 Settled minor insurance claims



Based on: Two commercial claims were filed for minor body damage and both were settled as property damage.

4 No major damage or total loss



Based on: There is no evidence of total-loss declaration, flood, fire, or theft damage in the vehicle history.



Financing

Clean title supports standard financing options.



Insurance

Clean title means there are no title issues affecting insurance coverage.



Resale Value

Clean title supports strong resale value in the used car market.

Ownership History

Vehicle ownership and transfer records

1 Owner



1

TOTAL OWNERS



0

COMPULSORY TRANSFERS



Single owner vehicle with no transfer history recorded.

Body Appearance Checklist

Detailed inspection results for all body panels

GRADE

S

NORMAL

11 / 11

MINOR

0 / 11

MAJOR

0 / 11



Excellent Condition

Vehicle body and structure are in excellent condition with no damage detected



Detailed Panel Status

Front Frame	✓ Normal	No damage detected
Rear Frame	✓ Normal	No damage detected
Roof Structure	✓ Normal	No damage detected
Undercarriage	✓ Normal	No damage detected
Front Left Panel	✓ Normal	No damage detected
Rear Left Panel	✓ Normal	No damage detected
Middle Left Panel	✓ Normal	No damage detected
Front Right Panel	✓ Normal	No damage detected
Rear Right Panel	✓ Normal	No damage detected
Middle Right Panel	✓ Normal	No damage detected

Interior

 Normal

No damage detected

Accident & Damage Records

Reported collision and damage history

 2 Records

1 Collision

Minor

 Affected Area	 Data Source	 Type
Unknown	Insurance Records	Collision

Minor collision incident recorded

2 Collision

Minor

 Affected Area	 Data Source	 Type
Unknown	Insurance Records	Collision

Minor collision incident recorded

 2 minor collisions recorded, no major incidents

Mileage Verification Timeline

Complete odometer reading history from registration and service records




CURRENT MILEAGE

56,876 km

 ODOMETER TREND

— Mileage (km)

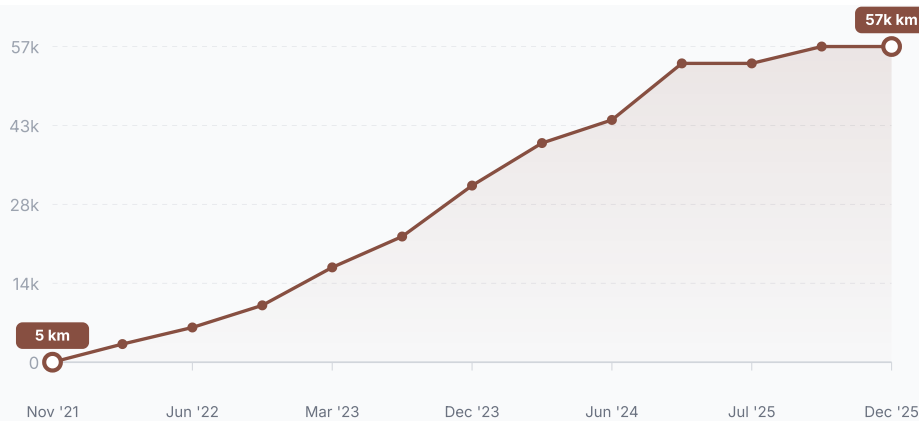

56,871

km / year

AVG ANNUAL



13

entries

TOTAL RECORDS



Nov 2021

5 km

FIRST RECORD



Dec 2025

56,876 km

LATEST RECORD

ALL RECORDS

DATE	MILEAGE	SOURCE	STATUS
Nov 2021	5 km	Registration	 Verified
Jan 2022	3,271 km +3,266	Service Record	 Verified
Jun 2022	6,262 km +2,991	Service Record	 Verified
Oct 2022	10,247 km +3,985	Service Record	 Verified
Mar 2023	17,087 km +6,840	Service Record	 Verified
Jul 2023	22,647 km +5,560	Service Record	 Verified

DATE	MILEAGE	SOURCE	STATUS
Dec 2023	31,828 km +9,181	Service Record	✓ Verified
May 2024	39,487 km +7,659	Service Record	✓ Verified
Jun 2024	43,653 km +4,166	Service Record	✓ Verified
Jul 2025	53,839 km +10,186	Service Record	✓ Verified
Jul 2025	53,840 km +1	Service Record	✓ Verified
Nov 2025	56,876 km +3,036	Service Record	✓ Verified
Dec 2025	56,876 km	Current Reading	✓ Verified



Odometer Verified

Mileage Verified - No Anomalies Detected



Maintenance Record Summary

Complete service history with detailed maintenance records and parts replacement

13 Records



LAST SERVICE

1760371200

Most recent service visit



OIL CHANGES

10 services

Oil & lubrication services



PARTS REPLACED

10 services

Service visits with parts work



Maintenance History Timeline

Chronological record of all services

**1760371200** **LATEST****Maintenance** **56,876 km** **Yes**

100,000 km scheduled maintenance; Additional: air conditioner service, inspection.

**PARTS & WORK**

- Lexus OEM windshield washer fluid
- spark plugs
- oil filter assembly
- gasket (for oil pan drain plug)
- Lexus OEM motor oil 0W20 20L
- Lexus OEM fuel injector cleaner

**1760284800****Painting** **56,876 km** **No**

Engine hood painting.

**1751299200****Repair** **53,840 km** **No**

Rear bumper; right rear door panel; front bumper; millimeter-wave radar sensor assembly.

**1751212800****Maintenance** **53,839 km** **Yes**

90,000 km maintenance.

**PARTS & WORK**

- Lexus OEM windshield washer fluid
- oil filter assembly
- gasket (for oil pan drain plug)
- cabin air filter
- Lexus OEM motor oil 0W20 20L
- Lexus OEM fuel injector cleaner

**1728403200****Maintenance**



 43,653 km  Yes

80,000 km scheduled CVT maintenance.

 PARTS & WORK

-  Lexus OEM windshield washer fluid
-  oil filter assembly
-  gasket (for oil pan drain)
-  O-ring (for fuel pump)
-  air filter element assembly
-  Lexus OEM motor oil 0W20 20L
-  Lexus OEM brake fluid
-  Lexus OEM fuel injector cleaner
-  O-ring No.1 (for main fuel valve)
-  fuel tank pipe clamp
-  fuel intake assembly



 1715270400

Maintenance

 39,487 km  Yes

70,000 km scheduled rear differential/case maintenance.

 PARTS & WORK

-  Lexus OEM windshield washer fluid
-  oil filter assembly
-  gasket (for oil pan drain)
-  cabin air filter
-  Lexus OEM motor oil 0W20 20L
-  Lexus OEM fuel injector cleaner

 1701014400

Maintenance

 31,828 km  Yes

Additional: air conditioning service; 60,000 km scheduled CVT maintenance.

 PARTS & WORK

-  Lexus OEM motor oil 0W20 200L
-  Lexus OEM windshield washer fluid
-  oil filter assembly
-  gasket (for oil pan drain)
-  Lexus OEM fuel injector cleaner



1689177600

Maintenance

22,647 km Yes

50,000 km scheduled rear differential/case maintenance.

PARTS & WORK

- ✓ Lexus OEM motor oil 0W20 200L
- ✓ Lexus OEM windshield washer fluid
- ✓ oil filter assembly
- ✓ gasket (for oil pan drain)
- ✓ cabin air filter
- ✓ Lexus OEM fuel injector cleaner



1678723200

Maintenance

17,087 km Yes

Additional: air conditioning service; 40,000 km scheduled CVT maintenance.

PARTS & WORK

- ✓ Lexus OEM motor oil 0W20 200L
- ✓ Lexus OEM windshield washer fluid
- ✓ oil filter assembly
- ✓ gasket (for oil pan drain)
- ✓ air filter element assembly
- ✓ Lexus OEM brake fluid
- ✓ Lexus OEM fuel injector cleaner



1666368000

Maintenance

10,247 km Yes

30,000 km scheduled rear differential/case maintenance.

PARTS & WORK

- ✓ Lexus OEM motor oil 0W20 200L
- ✓ Lexus OEM windshield washer fluid
- ✓ oil filter assembly
- ✓ gasket (for oil pan drain)
- ✓ air purification filter
- ✓ Lexus OEM fuel injector cleaner



1654358400

Maintenance



6,262 km Mixed

Additional: air conditioning service; basic inspection; 20,000 km scheduled rear differential/case maintenance.

- PARTS & WORK**
- ✓ Lexus OEM windshield washer fluid
 - ✓ oil filter assembly
 - ✓ gasket (for oil pan drain)
 - ✓ Lexus OEM motor oil 0W20 20L
 - ✓ Lexus OEM fuel injector cleaner



1643212800 Maintenance

3,271 km Mixed

Basic inspection; 10,000 km scheduled rear differential/case maintenance.

- PARTS & WORK**
- ✓ Lexus OEM windshield washer fluid
 - ✓ oil filter assembly
 - ✓ gasket (for oil pan drain)
 - ✓ air purification filter
 - ✓ Lexus OEM fuel injector cleaner
 - ✓ Lexus OEM motor oil 0W20 20L

1635609600 Inspection

5 km Yes

Additional: air conditioning service; pre-delivery inspection.

Insurance Claims

Vehicle insurance claim history

2 Claims

2
COMMERCIAL

Property Damage
COMMERCIAL Settled

Reference	Damage	Provider
Claim #1	Body Damage	Commercial Insurance

Claim for vehicle body repair after minor collision



Property Damage

COMMERCIAL

● Settled



Reference

Claim #2



Damage

Body Damage



Provider

Commercial Insurance

Claim for bumper dent repair



2 claims filed: 2 commercial and 0 compulsory



Report Disclaimer & Trust Signals

This vehicle history report is compiled from multiple trusted data sources to provide you with comprehensive information about this vehicle's past.

DATA SOURCES



State DMV Records



Insurance Companies



Service Centers



Auto Auctions



Collision Repair Facilities



Fire & Police Departments



IMPORTANT NOTICE

This report is provided for informational purposes only. While we strive for accuracy, China Vehicle History does not guarantee the completeness or accuracy of the information contained herein. This report should be used as one of several tools in evaluating a vehicle purchase. We recommend a professional mechanical inspection before any vehicle purchase.